

1A

BOOK 4719

INDEX DIAGRAM

Township 2 North, Range 22 West

		3	4		
6	5 2	3 3	4	3	2
7	8	9	10	11	12
18 1	2 17	16	15	14	13
19	20	21	22	23	24
30	29	28	27	26	25
31	32	33	34	35	36

1

BOOK 4719

Township 2 North, Range 22 West, G&SRM, Arizona

16

CHAINS

The township was surveyed in 1916-17 by W. B. Kimmel, U.S. Surveyor, under Group 47. The west boundary and subdivision of the fractional township was dependently resurveyed in 1961 by Donald A. Cannon, Cadastral Surveyor, and Leonard W. Murphy, Surveying Technician. The north boundary was dependently resurveyed in 1961 by Floyd A. Brooks, Cadastral Surveyor, William W. Glenn, Cadastral Surveyor, and Leonard W. Murphy, Surveying Technician, all under Group 355.

The following field notes are those of the remonumentation or relocation of certain corners along the left and right banks of the Colorado River in Township 2 North, Range 22 West, that were in danger of being destroyed by revetment or access road work by the Bureau of Reclamation.

The approval of the Special Instructions on January 26, 1965, gave authority to proceed with the remonumentation or relocation.

A field crew furnished by the Bureau of Reclamation assisted in the remonumentation or relocation of the corners involved. A one-minute transit was used for alignment and a standard steel tape was used to measure the distances.

The witness point at 44.65 chs. N. of the CC. of secs 19 and 30 and on the W. bdy. of the Tp., is monumented by an iron post $2\frac{1}{2}$ ins. diam., situated in an area of proposed haul road and dressed bank on the left bank of the Colorado River.

I remove the iron post and its accessories.

At a point 42.60 chs. N., on the W. bdy. of sec. 19 (2.60 chs. N. of the $\frac{1}{4}$ sec. cor. of sec. 19 only)

I reset the iron post 24 ins. in the ground and remarked the brass cap to read

W P
S24 S19
R23W R22W
T2N
1965
1961

Set a redwood post, 7 ft. long, 4 ins. sq., 36 ins. in the ground, alongside the iron post as a guard stake.

The witness point at 36.87 chs. N. $89^{\circ}58'$ W. of the cor. of secs. 17, 18, 19 and 20, on the line bet. secs. 18 and 19, is monumented by an iron post $2\frac{1}{2}$ ins. diam., situated in an area of a proposed haul road and dressed bank on the left bank of the Colorado River.

I remove the iron post and its accessories.

At a point 34.90 chs. N. $89^{\circ}58'$ W. of the cor. of secs. 17, 18, 19 and 20, on the line bet. secs. 18 and 19

2

CHAINS

I reset the iron post 24 ins. in the ground and remarked the brass cap to read

T2N
S18
W P _____
S19
R22W
1961
1965

Set a redwood post, 7 ft. long, 4 ins. sq., 36 ins. in the ground, alongside the iron post as a guard stake.

The witness point at 33.45 chs. N. 0°03' W. of the cor. of secs. 17, 18, 19 and 20, on the line bet. secs. 17 and 18, monumented by an iron post 2½ ins. diam., is situated in an area of a proposed haul road on the left bank of the Colorado River.

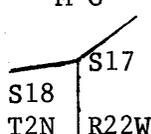
There is no other safe place in the immediate area to relocate this witness point; I remove the iron post and destroy the accessories.

The meander corner on the left bank of the Colorado River at 34.06 chs. N. 0°03' W. of the cor. of secs. 17, 18, 19 and 20, on the line bet. secs. 17 and 18, monumented by an iron post 2½ ins. diam., is situated in an area of a proposed haul road and bank cutting.

I remove the iron post and its accessories.

At a point 32.06 chs. N. 0°03' W. of the cor. of secs. 17, 18, 19 and 20, on the line bet. secs. 17 and 18, and in a secure position on a sandstone spur

I reset the iron post 24 ins. in the ground and remarked the brass cap to read

WC
M C

S18
T2N | R22W
1961
1965

Set a redwood post, 7 ft. long, 4 ins. sq., 36 ins. in the ground, alongside the iron post as a guard stake.

The witness point at 32.70 chs. W. of the cor. of secs. 4, 5, 8 and 9, on the line bet. secs. 5 and 8, and on the right bank of the Colorado River, was monumented by an iron post 2½ ins. diam. The iron post and its accessories have been obliterated through the erosion of the river bank. A proposed haul road and river bank revetment work in this area by the Bureau of Reclamation, and the leveling of the area to the W. by the Union Stockyards leaves no suitable point to remonument another witness point bet. the river bank and the ½ sec. cor. of secs. 5 and 8.

BOOK 4719

Township 2 North, Range 22 West, G&SRM, Arizona

3.

CHAINS

The witness point at 15.28 chs. N. $0^{\circ}04'$ E. of the cor. of secs. 4, 5, 8 and 9, on the line bet. secs. 4 and 5, monumented by an iron post $2\frac{1}{2}$ ins. diam., is situated in an area of a proposed haul road on the left bank of the Colorado River.

I remove the iron post and its accessories.

At a point 14.30 chs. N. $0^{\circ}04'$ E. of the cor. of secs. 4, 5, 8 and 9, on the line bet. secs. 4 and 5

I reset the iron post 24 ins. in the ground and remarked the brass cap to read

T2NR22W

W P

S5|S4

1965

1961

Set a redwood post, 7 ft. long, 4 ins. sq., 36 ins. in the ground, alongside the iron post as a guard stake.

The witness point at 23.50 chs. N. $0^{\circ}04'$ E. of the cor. of secs. 4, 5, 8 and 9, on the line bet. secs. 4 and 5, monumented by an iron post $2\frac{1}{2}$ ins. diam., is situated in an area of a proposed haul road and dressed bank on the right bank of the Colorado River.

I remove the iron post and its accessories.

At the same point

I reset the iron post with the brass cap 12 ins. below the surface and remarked the brass cap to read

T2NR22W

W P

S5|S4

1961

1965

Set a redwood post, 6 ft. long, 4 ins. sq., 24 ins. in the ground, 4 ft. S. of the iron post.

Angle Point No. 3 in sec. 4, on the traverse of the considered position of the 1923-24 left bank of the Colorado River in the area severed by the so-called Hauser Cut, is monumented by an iron post $2\frac{1}{2}$ ins. diam. at 22.62 chs. N. $84^{\circ}50'$ E. of Angle Point No. 2, and is situated on the present right bank of the Colorado River in an area of a proposed haul road and dressed bank.

I remove the iron post and its accessories.

At the same point

I reset the iron post with the top 24 ins. below the surface and remarked the brass cap to read

BOOK 4719

Township 2 North, Range 22 West, G&SRM, Arizona

4

4

CHAINS

A P 3 / S4

T2NR22W
1961
1965

Set a redwood post, 6 ft. long, 4 ins. sq., 24 ins. in the ground, 4 ft. S. of the iron post.

The witness point on the line bet. secs. 3 and 34, on the N. bdy. of the Tp., monumented in 1916 with an iron post, 1 inch diam., was found in 1961 at 20.27 chs. W. of the $\frac{1}{4}$ sec. cor. of secs. 3 and 34, and reported as being in good condition.

I find the brass cap to be missing from the iron post.

At the same point

I set an iron post 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, in a collar of stone, with brass cap mkd.

T3NR22W
S34
W P ———
S3
T2N
1965

The meander corner on the left bank of the Colorado River at 23.17 chs. W. of the $\frac{1}{4}$ sec. cor. of secs. 3 and 34, on the N. bdy. of the Tp. bet. secs. 3 and 34, is situated in an area of a proposed haul road and dressed bank.

I remove the iron post and its accessories.

At a point 21.27 chs. W. of the $\frac{1}{4}$ sec. cor. of secs. 3 and 34, on the N. bdy. of the Tp., bet. secs. 3 and 34

I reset the iron post 24 ins. in the ground and remarked the brass cap to read

T3NR22W
WC / S34
MC /
S3
T2N
1961
1965

Set a redwood post, 7 ft. long, 4 ins. sq., 36 ins. in the ground, alongside the iron post as a guard stake.

5

Form 4-680
(June 1963)

BOOK 4719
UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD ASSISTANTS

NAMES	CAPACITY
Floyd Crain	
Woodrow Fiero	
Wilbert Rhoades	
The above are Bureau of Reclamation personnel assigned to project work by Charles E. Culler, Chief, Palo Verde Field Division, U.S.B.R.	

BOOK 4719

CERTIFICATE OF SURVEY

I, Paul G. Bauer, HEREBY CERTIFY upon honor that, in pursuance of special instructions bearing date of the 26 day of January, 19 65, I have remonumented cadastral survey corners in Township 2 North, Range 22 West

of the Gila and Salt River Meridian, in the State of Arizona, which are represented in the foregoing field notes as having been executed by me and under my direction; and that said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

February 10, 1965 (Date)

Paul G. Bauer (Cadastral Surveyor)

(Date)

(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL Date FEB 25 1965

BUREAU OF LAND MANAGEMENT, Washington, D. C.

The foregoing field notes of the remonumentation of cadastral survey corners in Township 2 North, Range 22 West, of the Gila and Salt River Meridian in the State of Arizona,

executed by Paul G. Bauer, Cadastral Surveyor, having been critically examined and found correct, are hereby approved.

JUL 1 1965 (Date)

SE Hemington (Chief, Division of Engineering) NES

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in, is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)